Equipment Technical Bulletin D3000 Not Delivering Recharge Dose with Door Machine/Timed Mode



OVERVIEW/ISSUE

When D3000 is used on a door machine in potentiometertimed mode, the detergent pump recharge may not function.

EXPLANATION

This problem occurs if the D3000 PCB was previously programmed or controlled with a Uniview and Menu 2 was set to a"2" for conveyor mode at some point in history. D3000 PCBs or units that are new and whose default programmed values have not changed are not affected by this ETB.

SOLUTION

If you experience this problem you will need to connect a Uniview programmer to your D3000 PCB and reprogram the Menu 23 setting to "1" (Uniview-controlled) then change the Menu 2 setting to "2" ("DOOR"). Finally, go back to Menu 23 and set back to "0" (potentiometercontrolled). This resets the D3000 PCB to work properly.



Customer Service

TEL: 831 • 426 • 0882 TEL: 800 • 858 • 2382 (toll-free in U.S.A.) TEL: 800 • 468 • 4893 (toll-free in U.S.A)

FAX: 831 • 423 • 4573 FAX: 800 • 221 • 8416

http://www.beta-technology.com

Global Technical Customer Service North America:

TEL: 262 • 631 • 4461 (international)

Europe, Middle East & Africa: TEL: +1 630 • 513 • 9799

Asia Pacific:

TEL +1 86 21-50509900 x 2520

Japan:

TEL: +1 090-6506-5140 Latin America TEL: +1 - 541148428270

1

Beta Technology is ISO 9001 Certified